


NOTES:

1. THIS RESISTOR MAY NEED ADJUSTMENT. 330 OHMS IS A GOOD START. IF THE RADIO IS STILL TOO SENSITIVE IN FORMATION FLIGHT, INCREASE THE RESISTOR VALUE BY 2X STEPS. E.G., NEXT TRY IS 680 OHMS, THIRD TRY IS 1500 OHMS, ETC.

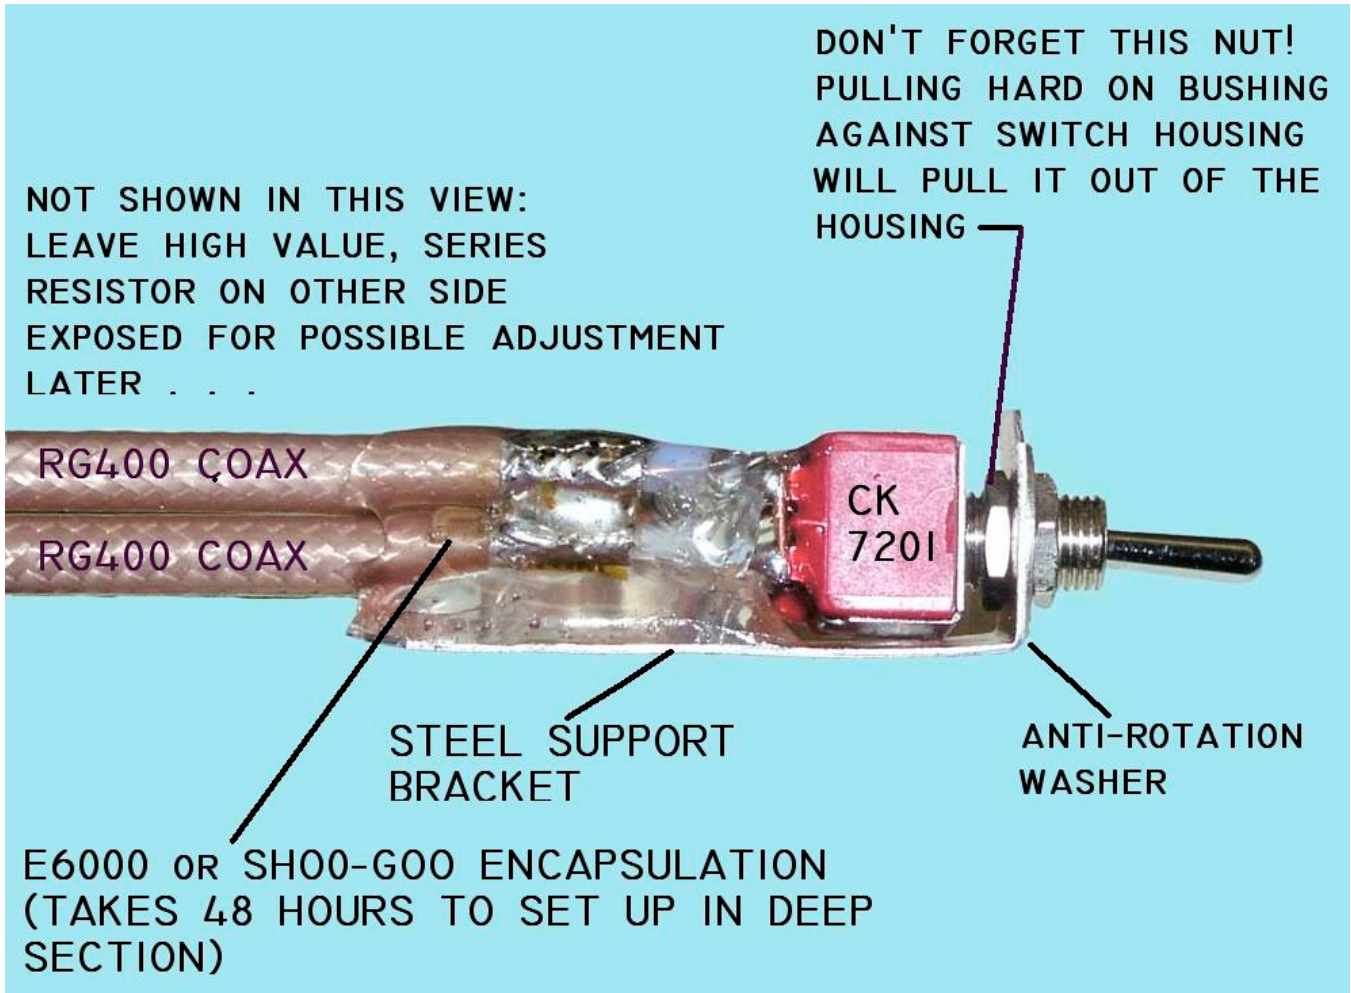

NOT SHOWN IN THIS VIEW:  
LEAVE HIGH VALUE, SERIES  
RESISTOR ON OTHER SIDE  
EXPOSED FOR POSSIBLE ADJUSTMENT  
LATER . . .

**DON'T FORGET THIS NUT!  
PULLING HARD ON BUSHING  
AGAINST SWITCH HOUSING  
WILL PULL IT OUT OF THE  
HOUSING**

RG400 COAX  
RG400 COAX

STEEL SUPPORT  
BRACKET

ANTI-ROTATION  
WASHER

E6000 OR SH00-G00 ENCAPSULATION  
(TAKES 48 HOURS TO SET UP IN DEEP  
SECTION)

TITLE	PAGE
FORMATION FLYING ATTENUATOR	